


# Installation Guide for HF/MF feeder WIREKIT-01 (992000-P)

457-0008.01

**Package content:**

 
 
 
ITEM NO.	Description	QTY.
1	Tube clamp Ø40	1
2	Shackle, 5/8"	3
3	KUM feeder cable 5m	1
4	Isolator for wire, 6kN, 63kV	1
5	Connector, Cable clamp 35-50mm <sup>2</sup>	1
6	Connector, Cable clamp 16-25mm <sup>2</sup>	1
7	Wire clamp Ø6	2
8	Thimble Ø7	2

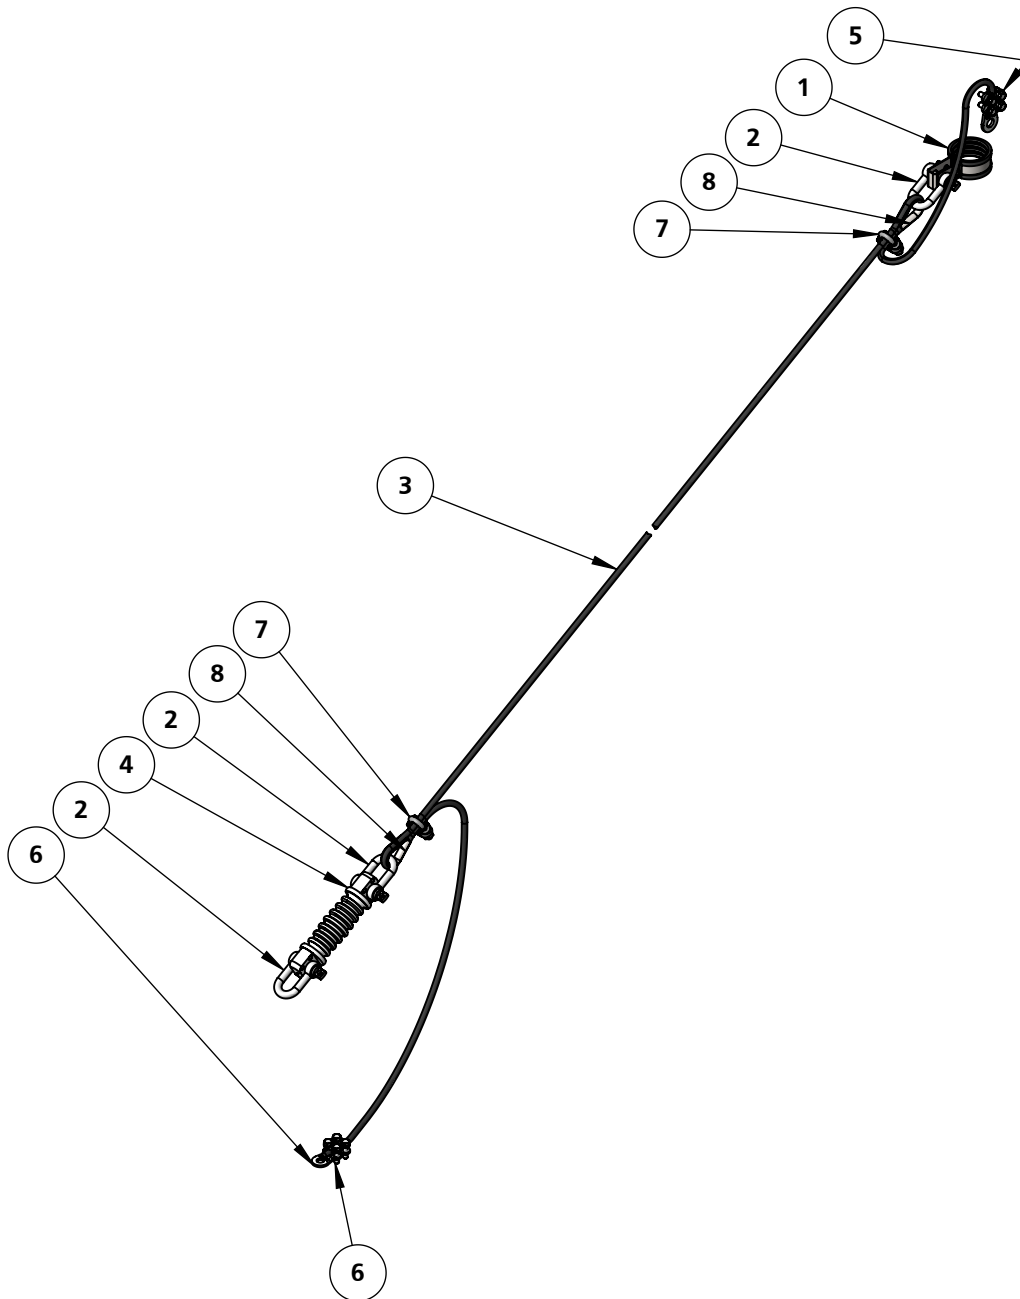

# Installation Guide

This is a guide only and does not form any contract or warranty

## Recommended cable stripping:



The two wire clamps on the connector needs to be flipped in order to make a secure connection to the cable

4: Mount the cable clamp pointing upwards to avoid water ingress in the cable and tighten the two nuts by 3Nm

1: Mount the tube clamp 50mm from the antenna screw

2: Mount the shackle & thimble and feed the wire through. Use wire (not included) to lock the shackle

3: Use anti-sieze on the bolt and fix the nut by max 1Nm

5: Mount the wire clamp leaving slack cable to connect the antenna

! Keep as much distance as possible between the cable and grounded objects

**DETAIL A**  
**SCALE 1 : 5**

6: Mount the two last shackles & Isolator to a suitable post

7: Feed the cable through the thimble & mount the wire clamp. The cable pulled taut (straight but not tight)

! Keep as much distance as possible between the cable and grounded objects

**DETAIL B**  
**SCALE 1 : 5**

8: Finally the cable clamp must be connected to the antenna tuner max 1m from the wire isolator with a slack cable

60° max.

A

B